Integrated management module error messages

Table 1. IMM error messages

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

Message	Severity	Description	Action
Numeric sensor Ambient Temp going high (upper critical) has asserted.	Error	An upper critical sensor going high has asserted.	Reduce the ambient temperature.
Numeric sensor Ambient Temp going high (upper non-recoverable) has asserted.	Error	An upper nonrecoverable sensor going high has asserted.	Reduce the ambient temperature.
Numeric sensor Planar 3.3V going low (lower critical) has asserted.	Error	A lower critical sensor going low has asserted.	(Trained service technician only) Replace the system board.
Numeric sensor Planar 3.3V going high (upper critical) has asserted.	Error	An upper critical sensor going high has asserted.	(Trained service technician only) Replace the system board.
Numeric sensor Planar 5V going low (lower critical) has asserted.	Error	A lower critical sensor going low has asserted.	(Trained service technician only) Replace the system board.
Numeric sensor Planar 5V going high (upper critical) has asserted.	Error	An upper critical sensor going high has asserted.	(Trained service technician only) Replace the system board.
Numeric sensor Planar VBAT going low (lower critical) has asserted.	Error	A lower critical sensor going low has asserted.	Replace the 3 V battery.
Numeric sensor Fan <i>n</i> A Tach going low (lower critical) has asserted. (<i>n</i> = fan number)	Error	A lower critical sensor going low has asserted.	 Reseat the failing fan <i>n</i>, which is indicated by a lit LED near the fan connector on the system board. Replace the failing fan.
Numeric sensor Fan <i>n</i> B Tach going low (lower critical) has asserted. (<i>n</i> = fan number)	Error	A lower critical sensor going low has asserted.	 (n = fan number) Reseat the failing fan n, which is indicated by a lit LED near the fan connector on the system board. Replace the failing fan. (n = fan number)
The connector System board has encountered a configuration error.	Error	An interconnect configuration error has occurred.	Reseat the front video cable on the system board.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

		T	1
The Processor CPU <i>n</i> Status has Failed with IERR. (<i>n</i> = microprocessor number)	Error	A processor failed - IERR condition has occurred.	 Make sure that the latest levels of firmware and device drivers are installed for all adapters and standard devices, such as Ethernet, SCSI, and SAS. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code. Run the DSA program for the hard disk drives and other I/O devices. (Trained service technician only) Replace microprocessor n. (n = microprocessor number)
An Over-Temperature Condition has been detected on the Processor CPU nStatus. (n = microprocessor number)	Error	An overtemperature condition has occurred for microprocessor <i>n</i> . (<i>n</i> = microprocessor number)	 Make sure that the fans are operating, that there are no obstructions to the airflow, that the air baffles are in place and correctly installed, and that the server cover is installed and completely closed. Make sure that the heat sink for microprocessor <i>n</i> is installed correctly. (Trained service technician only) Replace microprocessor <i>n</i>. (<i>n</i> = microprocessor number)

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

		T	_	
The Processor CPU <i>n</i> Status has Failed with FRB1/BIST condition. (<i>n</i> = microprocessor number)	Error	A processor failed - FRB1/BIST condition has occurred.	1.	Check for a UEFI firmware update. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code.
			2.	Make sure that the installed microprocessors are compatible with each other (see "Installing a microprocessor and heat sink" in the <i>Problem Determination and Service Guide</i> for information about microprocessor requirements).
			3.	(Trained service technician only) Reseat microprocessor <i>n</i> .
			4.	(Trained service technician only) Replace microprocessor n .
			(n	= microprocessor number)
The Processor CPU <i>n</i> Status has a Configuration Mismatch. (<i>n</i> = microprocessor number)	Error	A processor configuration mismatch has occurred.	1.	Make sure that the installed microprocessors are compatible with each other (see "Installing a microprocessor and heat sink" in the <i>Problem Determination and Service Guide</i> for information about microprocessor requirements).
			2.	(Trained service technician only) Replace the incompatible microprocessor.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

		I	Г
An SM BIOS Uncorrectable CPU complex error for Processor CPU nStatus has asserted. (n = microprocessor number)	Error	An SMBIOS uncorrectable CPU complex error has asserted.	Check for a UEFI firmware update. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code.
			 Make sure that the installed microprocessors are compatible with each other (see "Installing a microprocessor and heat sink" in the <i>Problem Determination and Service Guide</i> for information about microprocessor requirements). (Trained service technician only) Reseat microprocessor <i>n</i>. (Trained service technician only) Replace microprocessor <i>n</i>.
			(n = microprocessor number)
Sensor CPU <i>n</i> OverTemp has transitioned to critical from a less severe state. (<i>n</i> = microprocessor number)	Error	A sensor has changed to Critical state from a less severe state.	1. Make sure that the fans are operating, that there are no obstructions to the airflow, that the air baffles are in place and correctly installed, and that the server cover is installed and completely closed.
			2. Make sure that the heat sink for microprocessor <i>n</i> is installed correctly.
			3. (Trained service technician only) Replace microprocessor <i>n</i> .
			(n = microprocessor number)

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is
- See PARTS LISTING in the Problem Determination and Service Guide to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

		T	
Sensor CPU <i>n</i> OverTemp has transitioned to non-recoverable from a less severe state. (<i>n</i> = microprocessor number)	Error	A sensor has changed to Nonrecoverable state from a less severe state.	1. Make sure that the fans are operating, that there are no obstructions to the airflow, that the air baffles are in place and correctly installed, and that the server cover is installed and completely closed.
			2. Make sure that the heat sink for microprocessor <i>n</i> is installed correctly.
			3. (Trained service technician only) Replace microprocessor <i>n</i> .
			(n = microprocessor number)
Sensor CPU <i>n</i> OverTemp has transitioned to critical from a non-recoverable state. (<i>n</i> = microprocessor number)	Error	A sensor has changed to Critical state from Nonrecoverable state.	1. Make sure that the fans are operating, that there are no obstructions to the airflow, that the air baffles are in place and correctly installed, and that the server cover is installed and completely closed.
			2. Make sure that the heat sink for microprocessor <i>n</i> is installed correctly.
			3. (Trained service technician only) Replace microprocessor <i>n</i> .
			(n = microprocessor number)
Sensor CPU <i>n</i> OverTemp has transitioned to non-recoverable. (<i>n</i> = microprocessor number)	Error	A sensor has changed to Nonrecoverable state.	1. Make sure that the fans are operating, that there are no obstructions to the airflow, that the air baffles are in place and correctly installed, and that the server cover is installed and completely closed.
			2. Make sure that the heat sink for microprocessor <i>n</i> is installed correctly.
			3. (Trained service technician only) Replace microprocessor <i>n</i> .
			(n = microprocessor number)

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

	1		_	
A bus timeout has occurred on system %1. (%1 = CIM_ComputerSystem.Elements)		A bus timeout has occurred.	2.	Remove the adapter from the PCI slot that is indicated by a lit LED. Replace the riser-card assembly. Remove all PCI adapters. (Trained service technicians only) Replace the system board.
A software NMI has occurred on system %1. (%1 = CIM_ComputerSystem.Elements)	Error entName)	A software NMI has occurred.		Check the device driver. Reinstall the device driver.
The System %1 encountered a POST Error. (%1 = CIM_ComputerSystem.Elements)	Error entName)	A POST error has occurred. (Sensor = ABR Status)		Recover the UEFI firmware from the backup page: a. Restart the server. b. At the prompt, press F3 to recover the firmware. Update the UEFI firmware to the latest level. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code.
The System %1 encountered a POST Error. (%1 = CIM_ComputerSystem.Elem	Error entName)	A POST error has occurred. (Sensor = Firmware Error)		Update the UEFI firmware on the primary page. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code. (Trained service technician only) Replace the system board.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

	*			
A Uncorrectable Bus Error has occurred on system %1. (%1 = CIM_ComputerSystem.Elements)	Error entName)	A bus uncorrectable error has occurred. (Sensor = Critical Int PCI)	2. 3.	Remove the adapter from the indicated PCI slot. Check for a UEFI firmware update.
				Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code.
			5.	(Trained service technician only) Replace the system board.
A Uncorrectable Bus Error	Error	A bus uncorrectable error has	1.	Check the system-event log.
has occurred on system %1. (%1 = CIM_ComputerSystem.Elemo	entName)	occurred. (Sensor = Critical Int CPU)	2.	Check the microprocessor error LEDs.
Chvi_computersystem.Exem	in varie,		3.	Remove the failing microprocessor from the system board.
			4.	Check for a UEFI firmware update. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that
				the latest level of code is supported for the cluster solution before you update the code.
			5.	Make sure that the two microprocessors are matching.
			6.	(Trained service technician only) Replace the system board.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

			Т .	
A Uncorrectable Bus Error has occurred on system %1. (%1 = CIM_ComputerSystem.Elemonth)	Error entName)	A bus uncorrectable error has occurred. (Sensor = Critical Int DIM)	2.	Check the system-event log. Check the DIMM error LEDs. Remove the failing DIMM from the system board.
			4.	Check for a UEFI firmware update. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code.
			5.	Make sure that the installed DIMMs are supported and configured correctly.
			6.	(Trained service technician only) Replace the system board.
Sensor Sys Board Fault has	Error	A sensor has changed to Critical	1.	Check the system-event log.
transitioned to critical from a less severe state.		state from a less severe state.	2.	Check for an error LED on the system board.
			3.	Replace any failing device.
			4.	Check for a UEFI firmware update. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the
			5.	code. (Trained service technician only) Replace the system board.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the Problem Determination and Service Guide to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

trained service technician	•		
The Power Supply (Power Supply: <i>n</i>) has Failed. (<i>n</i> = power supply number)	Error	Power supply <i>n</i> has failed. (<i>n</i> = power supply number)	 If the power-on LED is lit, complete the following steps: Reduce the server to the minimum configuration. Reinstall the components one at a time, restarting the server each time. If the error recurs, replace the component that you just reinstalled. Reseat power supply n. Replace power supply n.
Sensor PS <i>n</i> Fan Fault has transitioned to critical from a less severe state. (<i>n</i> = power supply number)	Error	A sensor has changed to Critical state from a less severe state.	 (n = power supply number) Make sure that there are no obstructions, such as bundled cables, to the airflow from the power-supply fan. Replace power supply n. (n = power supply number)
Sensor VT Fault has transitioned to non-recoverable.	Error	A sensor has changed to Nonrecoverable state.	 Check the power-supply LEDs. Follow the actions in "Power supply LEDs" in the <i>Problem Determination and Service Guide</i>. Replace the failing power supply. (Trained service technician only) Replace the system board.
Sensor Pwr Rail A Fault has transitioned to non-recoverable.	Error	A sensor has changed to Nonrecoverable state.	 Turn off the server and disconnect it from power. Remove the optical drive, fans, hard disk drives, and hard disk drive backplane. Restart the server. Reinstall each device, one at a time, starting the server each time to isolate the failing device. Replace the failing device. (Trained service technician only) Replace the system board.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

	T	T	T
Sensor Pwr Rail B Fault has transitioned to non-recoverable.	Error	A sensor has changed to Nonrecoverable state.	Turn off the server and disconnect it from power.
			2. Remove the optical drive, fans, hard disk drives, and hard disk drive backplane.
			3. Restart the server.
			4. Reinstall each device, one at a time, starting the server each time to isolate the failing device.
			5. Replace the failing device.
			6. (Trained service technician only) Replace the system board.
Sensor Pwr Rail C Fault has transitioned to	Error	A sensor has changed to Nonrecoverable state.	Turn off the server and disconnect it from power.
non-recoverable.			2. (Trained service technician only) Remove the SAS/SATA RAID riser card, the DIMMs in connectors 1 through 8, and the microprocessor in socket 1.
			3. Restart the server.
			4. Reinstall each device, one at a time, starting the server each time to isolate the failing device.
			5. Replace the failing device.
			6. (Trained service technician only) Replace the system board.
Sensor Pwr Rail D Fault has transitioned to	Error	A sensor has changed to Nonrecoverable state.	Turn off the server and disconnect it from power.
non-recoverable.			2. (Trained service technician only) Remove the microprocessor from socket 1.
			3. Restart the server.
			4. Reinstall the microprocessor in socket 1 and restart the server.
			5. (Trained service technician only) Replace the failing microprocessor.
			6. (Trained service technician only) Replace the system board.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

trained service technician	•		
Sensor Pwr Rail E Fault has transitioned to non-recoverable.	Error	A sensor has changed to Nonrecoverable state.	 Turn off the server and disconnect it from power. (Trained service technician only) Remove the PCI riser card from PCI riser-card connector 2 and the microprocessor from socket 2. Restart the server. Reinstall each device, one at a time, starting the server each time to isolate the failing device.
			5. Replace the failing device.6. (Trained service technician only) Replace the system board.
Sensor PS <i>n</i> Therm Fault has transitioned to critical from a less severe state. (<i>n</i> = power supply number)	Error	A sensor has changed to Critical state from a less severe state.	 Make sure that there are no obstructions, such as bundled cables, to the airflow from the power-supply fan. Replace power supply <i>n</i>.
			(n = power supply number)
Redundancy Cooling Zone 1 has been reduced.	Error	Redundancy has been lost and is insufficient to continue operation.	 Make sure that the connectors on fans 1 and 2 are not damaged. Make sure that the fan 1 and 2 connectors on the system board are not damaged. Make sure that the fans are correctly installed. Reseat the fans. Replace the fans.
Sensor RAID Error has	Error	A sensor has changed to Critical	_
transitioned to critical from a less severe state.		state from a less severe state.	 Check the hard disk drive LEDs. Reseat the hard disk drive for which the status LED is lit. Replace the defective hard disk drive.
The Drive <i>n</i> Status has been removed from unit Drive 0 Status. (<i>n</i> = hard disk drive number)	Error	A drive has been removed.	Reseat hard disk drive <i>n</i> . (<i>n</i> = hard disk drive number)

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

trained service technician	1.		
The Drive <i>n</i> Status has been disabled due to a detected fault. (<i>n</i> = hard disk drive number)	Error	A drive has been disabled because of a fault.	 Run the hard disk drive diagnostic test on drive n. Reseat the following components: Hard disk drive Cable from the system board to the backplane Replace the following components one at a time, in the order shown, restarting the server each time: Hard disk drive Cable from the system board to the backplane Hard disk drive backplane (n = hard disk drive number)
Array %1 is in critical condition. (%1 = CIM_ComputerSystem.Elem	Error entName)	An array is in Critical state. (Sensor = Drive <i>n</i> Status) (<i>n</i> = hard disk drive number)	Replace the hard disk drive that is indicated by a lit status LED.
Array %1 has failed. (%1 = CIM_ComputerSystem.Elem	Error entName)	An array is in Failed state. (Sensor = Drive <i>n</i> Status) (<i>n</i> = hard disk drive number)	Replace the hard disk drive that is indicated by a lit status LED.
Memory uncorrectable error detected for DIMM All DIMMs on Memory Subsystem All DIMMs.	Error	A memory uncorrectable error has occurred.	 If the server failed the POST memory test, reseat the DIMMs. Replace any DIMM that is indicated by a lit error LED. Note: You do not have to replace DIMMs by pairs. Run the Setup utility to enable all the DIMMs. Run the DSA memory test.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

		T	
Memory Logging Limit Reached for DIMM All DIMMs on Memory Subsystem All DIMMs.	Error	The memory logging limit has been reached.	 Update the UEFI to the latest level. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code. Reseat the DIMMs and run the DSA memory test. Replace any DIMM that is indicated by a lit error LED.
Memory DIMM Configuration Error for All DIMMs on Memory Subsystem All DIMMs.	Error	A DIMM configuration error has occurred.	Make sure that DIMMs are installed in the correct sequence and have the same size, type, speed, and technology.
Memory uncorrectable error detected for DIMM One of the DIMMs on Memory Subsystem One of the DIMMs.	Error	A memory uncorrectable error has occurred.	 If the server failed the POST memory test, reseat the DIMMs. Replace any DIMM that is indicated by a lit error LED. Note: You do not have to replace DIMMs by pairs. Run the Setup utility to enable all the DIMMs. Run the DSA memory test.
Memory Logging Limit Reached for DIMM One of the DIMMs on Memory Subsystem One of the DIMMs.	Error	The memory logging limit has been reached.	1. Update the UEFI to the latest level. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code. 2. Reseat the DIMMs and run the DSA memory test.
			3. Replace any DIMM that is indicated by a lit error LED.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

trained service technician	•		
Memory DIMM Configuration Error for One of the DIMMs on Memory Subsystem One of the DIMMs.	Error	A DIMM configuration error has occurred.	Make sure that DIMMs are installed in the correct sequence and have the same size, type, speed, and technology.
Memory uncorrectable error detected for DIMM <i>n</i> Status on Memory Subsystem DIMM <i>n</i> Status. (<i>n</i> = DIMM number)	Error	A memory uncorrectable error has occurred.	 If the server failed the POST memory test, reseat the DIMMs. Replace any DIMM that is indicated by a lit error LED. Note: You do not have to replace DIMMs by pairs. Run the Setup utility to enable all the DIMMs. Run the DSA memory test. (Trained service technician only) Replace the system board.
Memory Logging Limit Reached for DIMM nStatus on Memory Subsystem DIMMnStatus. (n = DIMM number)	Error	The memory logging limit has been reached.	 Update the UEFI to the latest level. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code. Reseat the DIMMs and run the DSA memory test. Replace any DIMM that is indicated by a lit error LED.
Memory DIMM Configuration Error for DIMM <i>n</i> Status on Memory Subsystem DIMM <i>n</i> Status. (<i>n</i> = DIMM number)	Error	A DIMM configuration error has occurred.	Make sure that DIMMs are installed in the correct sequence and have the same size, type, speed, and technology.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is
- See PARTS LISTING in the Problem Determination and Service Guide to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

			1
Sensor DIMM <i>n</i> Temp has transitioned to critical from a less severe state. (<i>n</i> = DIMM number)	Error	A sensor has changed to Critical state from a less severe state.	1. Make sure that the fans are operating, that there are no obstructions to the airflow, that the air baffles are in place and correctly installed, and that the server cover is installed and completely closed.
			2. If a fan has failed, complete the action for a fan failure.
			3. Replace DIMM <i>n</i> .
			(n = DIMM number)
A PCI PERR has occurred on system %1. (%1 =	Error	A PCI PERR has occurred. (Sensor = All PCI Err)	 Check the riser-card LEDs. Reseat the affected adapters and riser card.
CIM_ComputerSystem.Elem	entName)		3. Update the server and adapter firmware (UEFI and IMM). Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code.
			4. Remove both adapters.
			5. Replace the PCIe adapter.
			6. Replace the riser card.
A PCI SERR has occurred on system %1. (%1 =	Error	A PCI SERR has occurred. (Sensor = All PCI Err)	 Check the riser-card LEDs. Reseat the affected adapters and riser card.
CIM_ComputerSystem.Elem	enuvame)		 3. Update the server and adapter firmware (UEFI and IMM). Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code. 4. Remove both adapters.
			5. Replace the PCIe adapter.
			6. Replace the riser card.
		1	1

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

A PCI PERR has occurred on system %1. (%1 = CIM_ComputerSystem.Eleme	Error entName)	A PCI PERR has occurred. (Sensor = PCI Slot <i>n</i> ; <i>n</i> = PCI slot number)	 Check the riser-card LEDs. Reseat the affected adapters and riser card. Update the server and adapter firmware (UEFI and IMM). Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster
			solution before you update the code.
			4. Remove the adapter from slot <i>n</i> .
			5. Replace the PCIe adapter.
			6. Replace riser card <i>n</i> .
			(n = PCI slot number)
A PCI SERR has occurred on system %1. (%1 = CIM_ComputerSystem.Elements)	Error	A PCI SERR has occurred. (Sensor = PCI Slot <i>n</i> ; <i>n</i> = PCI slot number)	 Check the riser-card LEDs. Reseat the affected adapters and riser card.
Chvi_ComputerSystem.Elene	entivame)		3. Update the server and adapter firmware (UEFI and IMM). Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code.
			4. Remove the adapter from slot <i>n</i> .
			5. Replace the PCIe adapter.
			6. Replace riser card <i>n</i> .
		I .	(n = PCI slot number)

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is
- See PARTS LISTING in the Problem Determination and Service Guide to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

A PCI PERR has occurred on system %1. (%1 = CIM_ComputerSystem.Elem	Error entName)	A PCI PERR has occurred. (Sensor = One of PCI Err)	2.	Check the riser-card LEDs. Reseat the affected adapters and riser card.
			3.	Update the server and adapter firmware (UEFI and IMM). Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code.
			1	Remove both adapters.
			1	Replace the PCIe adapter.
			l _	Replace the riser card.
			7.	(Trained service technician only) Replace the system board.
A PCI SERR has occurred	Error	A PCI SERR has occurred.	1.	Check the riser-card LEDs.
on system %1. (%1 = CIM_ComputerSystem.Elem	entName)	(Sensor = One of PCI Err)	2.	Reseat the affected adapters and riser card.
			3.	Update the server and adapter firmware (UEFI and IMM). Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code.
			1	Remove both adapters.
			1	Replace the PCIe adapter.
			l_	Replace the riser card.
			7.	(Trained service technician only) Replace the system board.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

Fault in slot System board on system %1. (%1 = CIM_ComputerSystem.Elemonth)	Error entName)		 Check the riser-card LEDs. Reseat the affected adapters and riser card. Update the server and adapter firmware (UEFI and IMM). Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code. Remove both adapters. Replace the PCIe adapter.
			6. Replace the riser card.7. (Trained service technician only) Replace the system board.
Redundancy Bckup Mem Status has been reduced.	Error	Redundancy has been lost and is insufficient to continue operation.	 Check the system-event log for DIMM failure events (uncorrectable or PFA) and correct the failures. Re-enable mirroring in the
			Setup utility.
Sensor Planar Fault has transitioned to critical from a less severe state.	Error	A sensor has changed to Critical state from a less severe state.	(Trained service technician only) Replace the system board.
IMM Network Initialization Complete.	Info	An IMM network has completed initialization.	No action; information only.
Certificate Authority %1 has detected a %2 Certificate Error. (%1 = IBM_CertificateAuthority.CA %2 = CIM_PublicKeyCertificate.Ele		A problem has occurred with the SSL Server, SSL Client, or SSL Trusted CA certificate that has been imported into the IMM. The Imperted certificate must contain a public key that corresponds to the key pair that was previously generated by the Generate a New Key and Certificate Signing Request link.	 Make sure that the certificate that you are importing is correct. Try importing the certificate again.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

Ethernet Data Rate modified from %1 to %2 by user %3. (%1 = CIM_EthernetPort.Speed; %2 = CIM_EthernetPort.Speed; %3 = user ID)	Info	A user has modified the Ethernet port data rate.	No action; information only.
Ethernet Duplex setting modified from %1 to %2 by user %3. (%1 = CIM_EthernetPort.FullDuple %2 = CIM_EthernetPort.FullDuple %3 = user ID)		A user has modified the Ethernet port duplex setting.	No action; information only.
Ethernet MTU setting modified from %1 to %2 by user %3. (%1 = CIM_EthernetPort.ActiveMax %2 = CIM_EthernetPort.ActiveMax %3 = user ID)			No action; information only.
Ethernet Duplex setting modified from %1 to %2 by user %3. (%1 = CIM_EthernetPort.NetworkA %2 = CIM_EthernetPort.NetworkA %3 = user ID)		A user has modified the Ethernet port MAC address setting.	No action; information only.
Ethernet interface %1 by user %2. (%1 = CIM_EthernetPort.EnabledSt %2 = user ID)	Info ate;	A user has enabled or disabled the Ethernet interface.	No action; information only.
Hostname set to %1 by user %2. (%1 = CIM_DNSProtocolEndpoint.) %2 = user ID)	Info Hostname;	A user has modified the host name of the IMM.	No action; information only.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

trained service technician	•	•	
IP address of network interface modified from %1 to %2 by user %3. (%1 = CIM_IPProtocolEndpoint.IPv %2 = CIM_StaticIPAssignmentSetti %3 = user ID)		A user has modified the IP address of the IMM.	No action; information only.
IP subnet mask of network interface modified from %1 to %2 by user %3s. (%1 = CIM_IPProtocolEndpoint.Sub %2 = CIM_StaticIPAssignmentSetti		A user has modified the IP subnet mask of the IMM. tMask;	No action; information only.
%3 = user ID)			
IP address of default gateway modified from %1 to %2 by user %3s. (%1 =	Info	A user has modified the default gateway IP address of the IMM.	No action; information only.
CIM_IPProtocolEndpoint.Ga %2 = CIM_StaticIPAssignmentSetti %3 = user ID)			
OS Watchdog response %1 by %2. (%1 = Enabled or Disabled; %2 = user ID)	Info	A user has enabled or disabled an OS Watchdog.	No action; information only.
DHCP[%1] failure, no IP address assigned. (%1 = IP address, xxx.xxx.xxx)	Info	A DHCP server has failed to assign an IP address to the IMM.	 Make sure that the network cable is connected. Make sure that there is a DHCP server on the network that can assign an IP address to the IMM.
Remote Login Successful. Login ID: %1 from %2 at IP address %3. (%1 = user ID; %2 = ValueMap(CIM_ProtocolEnd %3 = IP address, xxx.xxx.xxx.xxx)	Info point.Protocoll	A user has successfully logged in to the IMM. FType;	No action; information only.
Attempting to %1 server %2 by user %3. (%1 = Power Up, Power Down, Power Cycle, or Reset; %2 = IBM_ComputerSystem.Eleme %3 = user ID)	Info entName;	A user has used the IMM to perform a power function on the server.	No action; information only.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

Security: Userid: '%1' had %2 login failures from WEB client at IP address %3. (%1 = user ID; %2 = MaximumSuccessiveLoginFa (currently set to 5 in the firmware); %3 = IP address, xxx.xxx.xxx.xxx)	Error ilures	A user has exceeded the maximum number of unsuccessful login attempts from a Web browser and has been prevented from logging in for the lockout period.	 Make sure that the correct login ID and password are being used. Have the system administrator reset the login ID or password.
Security: Login ID: '%1' had %2 login failures from CLI at %3. (%1 = user ID; %2 = MaximumSuccessiveLoginFa (currently set to 5 in the firmware); %3 = IP address, xxx.xxx.xxx.xxx		A user has exceeded the maximum number of unsuccessful login attempts from the command-line interface and has been prevented from logging in for the lockout period.	 Make sure that the correct login ID and password are being used. Have the system administrator reset the login ID or password.
Remote access attempt failed. Invalid userid or password received. Userid is '%1' from WEB browser at IP address %2. (%1 = user ID; %2 = IP address, xxx.xxx.xxxx)	Error	A user has attempted to log in from a Web browser by using an invalid login ID or password.	 Make sure that the correct login ID and password are being used. Have the system administrator reset the login ID or password.
Remote access attempt failed. Invalid userid or password received. Userid is '%1' from TELNET client at IP address %2. (%1 = user ID; %2 = IP address, xxx.xxx.xxxx.xxx)	Error	A user has attempted to log in from a Telnet session by using an invalid login ID or password.	 Make sure that the correct login ID and password are being used. Have the system administrator reset the login ID or password.
The Chassis Event Log (CEL) on system %1 cleared by user %2. (%1 = CIM_ComputerSystem.Eleme %2 = user ID)	Info entName;	A user has cleared the IMM event log.	No action; information only.
IMM reset was initiated by user %1. (%1 = user ID)	Info	A user has initiated a reset of the IMM.	No action; information only.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

	•		
ENET[0] DHCP-HSTN=%1, DN=%2, IP@=%3, SN=%4, GW@=%5, DNS1@=%6. (%1 = CIM_DNSProtocolEndpoint.) %2 = CIM_DNSProtocolEndpoint.IPv %3 = CIM_IPProtocolEndpoint.IPv %4 = CIM_IPProtocolEndpoint.Sul %5 = IP address, xxx.xxx.xxxx.xxx; %6 = IP address, xxx.xxx.xxxx)	DomainName; 4Address;	The DHCP server has assigned an IMM IP address and configuration.	No action; information only.
ENET[0] IP-Cfg:HstName=%1, IP@%2, NetMsk=%3, GW@=%4. (%1 = CIM_DNSProtocolEndpoint.) %2 = CIM_StaticIPSettingData.IPv- %3 = CIM_StaticIPSettingData.Sub %4 = CIM_StaticIPSettingData.Def	4Address; netMask;	An IMM IP address and configuration have been assigned using client data.	No action; information only.
LAN: Ethernet[0] interface is no longer active.	Info	The IMM Ethernet interface has been disabled.	No action; information only.
LAN: Ethernet[0] interface is now active.	Info	The IMM Ethernet interface has been enabled.	No action; information only.
DHCP setting changed to by user %1. (%1 = user ID)	Info	A user has changed the DHCP mode.	No action; information only.
IMM: Configuration %1 restored from a configuration file by user %2. (%1 = CIM_ConfigurationData.Con %2 = user ID)	Info figurationNam	A user has restored the IMM configuration by importing a configuration file.	No action; information only.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is
- See PARTS LISTING in the Problem Determination and Service Guide to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

Watchdog %1 Screen Capture Occurred. (%1 = OS Watchdog or Loader Watchdog)	Error	An operating-system error has occurred, and the screen capture was successful.	 Reconfigure the watchdog timer to a higher value. Make sure that the IMM Ethernet over USB interface is enabled. Reinstall the RNDIS or cdc_ether device driver for the operating system. Disable the watchdog. Check the integrity of the installed operating system.
Watchdog %1 Failed to Capture Screen. (%1 = OS Watchdog or Loader Watchdog)	Error	An operating-system error has occurred, and the screen capture failed.	 Reconfigure the watchdog timer to a higher value. Make sure that the IMM Ethernet over USB interface is enabled. Reinstall the RNDIS or cdc_ether device driver for the operating system. Disable the watchdog. Check the integrity of the installed operating system. Update the IMM firmware. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code.
Running the backup IMM main application.	Error	The IMM has resorted to running the backup main application.	Update the IMM firmware. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is solved.
- See PARTS LISTING in the *Problem Determination and Service Guide* to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

trained service technician	•		
Please ensure that the IMM is flashed with the correct firmware. The IMM is unable to match its firmware to the server.	Error	The server does not support the installed IMM firmware version.	Update the IMM firmware to a version that the server supports. Important: Some cluster solutions require specific code levels or coordinated code updates. If the device is part of a cluster solution, verify that the latest level of code is supported for the cluster solution before you update the code.
IMM reset was caused by restoring default values.	Info	The IMM has been reset because a user has restored the configuration to its default settings.	No action; information only.
IMM clock has been set from NTP server %1. (%1 = IBM_NTPService.ElementNa	Info me)	The IMM clock has been set to the date and time that is provided by the Network Time Protocol server.	No action; information only.
SSL data in the IMM configuration data is invalid. Clearing configuration data region and disabling SSL+H25.	Error	There is a problem with the certificate that has been imported into the IMM. The imported certificate must contain a public key that corresponds to the key pair that was previously generated through the Generate a New Key and Certificate Signing Request link.	 Make sure that the certificate that you are importing is correct. Try to import the certificate again.
Flash of %1 from %2 succeeded for user %3. (%1 = CIM_ManagedElement.Elem %2 = Web or LegacyCLI; %3 = user ID)	Info entName;	A user has successfully updated one of the following firmware components: IMM main application IMM boot ROM UEFI firmware Diagnostics System power backplane Remote expansion enclosure power backplane Integrated service processor Remote expansion enclosure processor	No action; information only.
Flash of %1 from %2 failed for user %3. (%1 = CIM_ManagedElement.Elem %2 = Web or LegacyCLI; %3 = user ID)	Info entName;	An attempt to update a firmware component from the interface and IP address has failed.	Try to update the firmware again.

- Follow the suggested actions in the order in which they are listed in the Action column until the problem is
- See PARTS LISTING in the Problem Determination and Service Guide to determine which components are customer replaceable units (CRU) and which components are field replaceable units (FRU).
- If an action step is preceded by "(Trained service technician only)," that step must be performed only by a trained service technician.

The Chassis Event Log (CEL) on system %1 is 75% full. (%1 = CIM_ComputerSystem.Eleme	Info entName)	The IMM event log is 75% full. When the log is full, older log entries are replaced by newer ones.	To avoid losing older log entries, save the log as a text file and clear the log.
The Chassis Event Log (CEL) on system %1 is 100% full. (%1 = CIM_ComputerSystem.Eleme	Info entName)	The IMM event log is full. When the log is full, older log entries are replaced by newer ones.	To avoid losing older log entries, save the log as a text file and clear the log.
%1 Platform Watchdog Timer expired for %2. (%1 = OS Watchdog or Loader Watchdog; %2 = OS Watchdog or Loader Watchdog)	Error	A Platform Watchdog Timer Expired event has occurred.	 Reconfigure the watchdog timer to a higher value. Make sure that the IMM Ethernet over USB interface is enabled. Reinstall the RNDIS or cdc_ether device driver for the operating system. Disable the watchdog. Check the integrity of the installed operating system.
IMM Test Alert Generated by %1. (%1 = user ID)	Info	A user has generated a test alert from the IMM.	No action; information only.
Security: Userid: '%1' had %2 login failures from an SSH client at IP address %3. (%1 = user ID; %2 = MaximumSuccessiveLoginFa (currently set to 5 in the firmware); %3 = IP address, xxx.xxx.xxx.xxx	Error	A user has exceeded the maximum number of unsuccessful login attempts from SSH and has been prevented from logging in for the lockout period.	 Make sure that the correct login ID and password are being used. Have the system administrator reset the login ID or password.